



PROPOSED BOUTIQUE HOTEL, QUEENS ROAD, BELFAST



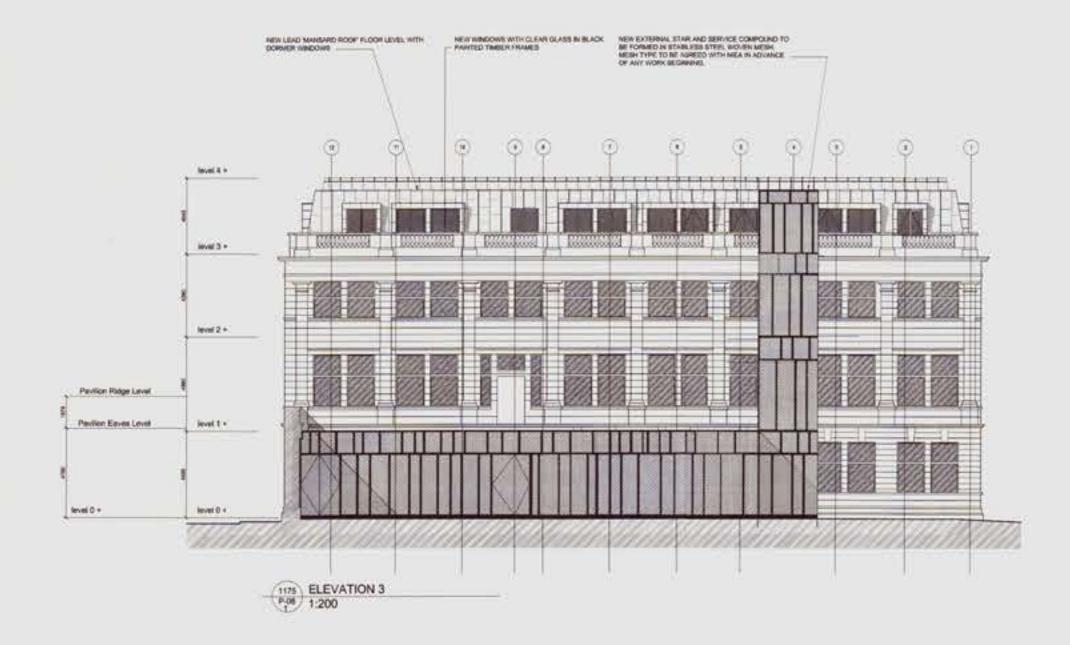


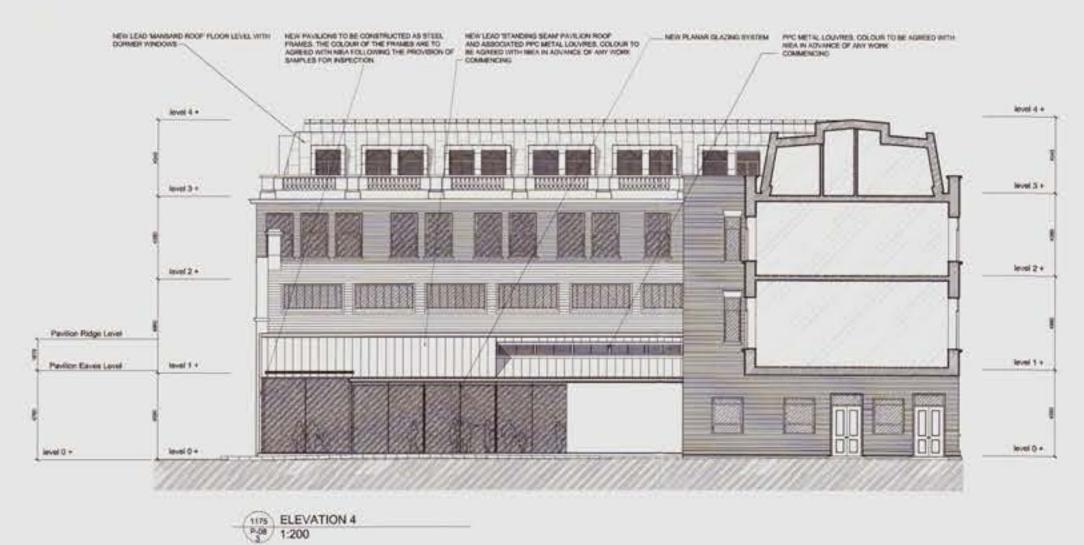

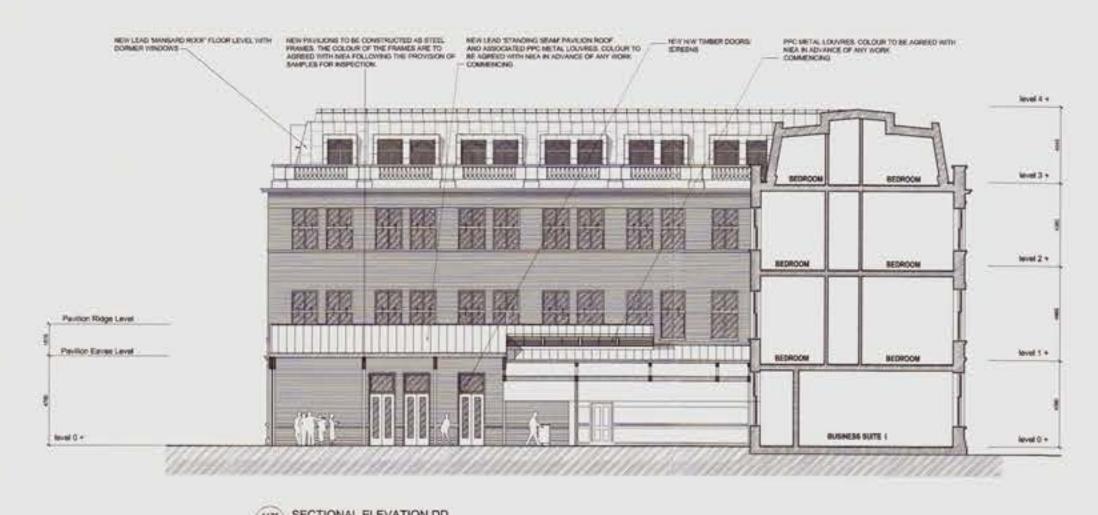

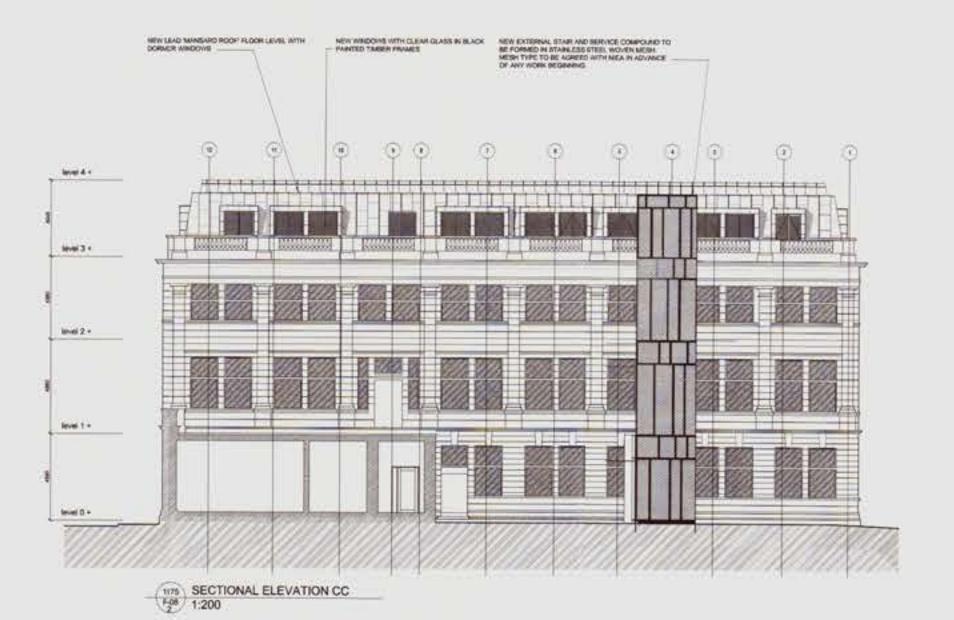

- GENERAL NOT
- 1.) ALL COLOURS TO BE AGREED BETWEEN ARCHITECT AND NIEA
- ALL REPAIRS TO EXISTING TIMBER AND DECORATIVE PLASTERWORK TO BE IN ACCORDANCE WITH SPECIALIST'S RECOMMENDATIONS.
- 3.) REVOER TO BE CONFIRMED. SAMPLE TO BE PROVIDED
- NO EXTERNAL PIPEWORK ISERVICES TO BE INCLUDED AT PRINCIPAL ELEVATIONS INCLUDING FANS, FLUES, OVERFLOWS AND WASTES (EXCEPTING RAIMWATER GOODS)
- SABPLE OF ARCHITECTURAL TBC BY HM: AND APPROVED BY NIEA. NO WORK TO COMMENCE PRIOR TCAPPROVAL.

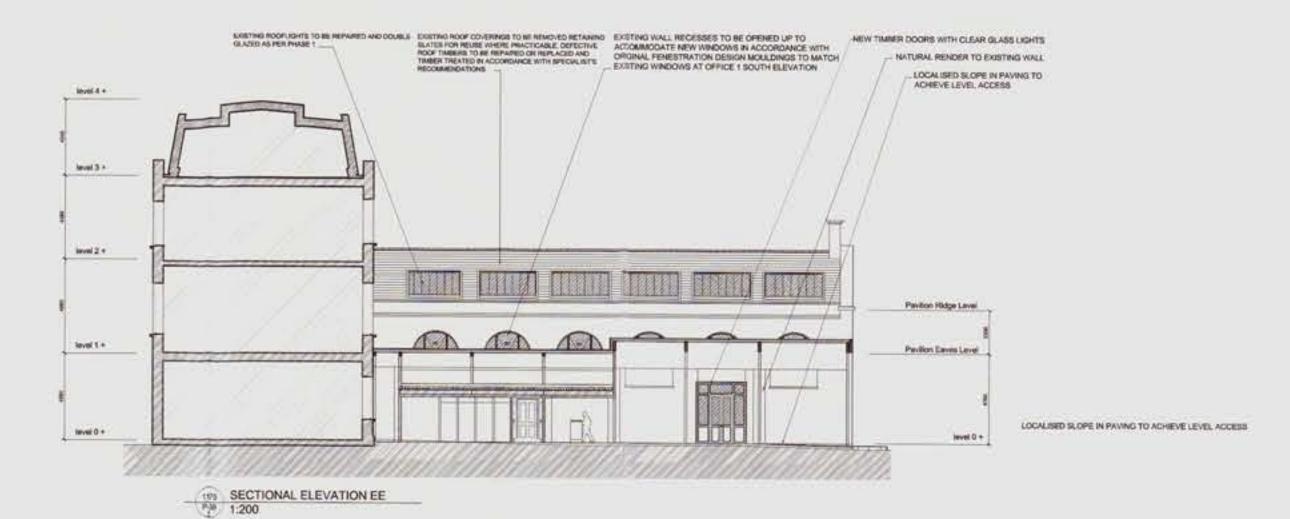

OCTOBER 2014

GENERAL NOTES:

- ALL COLOURS TO BE AGREED BETWEEN ARCHITECT
 AND NIEA
- ALL REPAIRS TO EXISTING TIMBER AND DECORATIVE
 PLASTERWORK TO BE IN ACCORDANCE WITH
 SPECIALIST'S RECOMMENDATIONS
- WERE POSSIBLE EXISTING INTERNAL PLASTER TO BE RETAINED HOWEVER, IF AFTER INVESTIGATION PLASTER REMOVAL IS REQUIRED.

 ANY ALTERATIONS TO BE AGREED WITH NIEA PRIOR TO WORK BEGINNING.
- WERE POSSIBLE EXISTING TIMBER SURROUNDS TO BE RETAINED HOWEVER IF AFTER INVESTIGATION REMOVAL IS REQUIRED AND AGREED WITH NIEA NEW TIMBER SURROUND WILL REPLICATE THE ORIGINAL PROFILE. THE EXTENT OF THIS WORK TO BE AGREED WITH NIEA PRIOR TO WORK BEGINNING.
- A SCHEDULE OF INTERNAL FINISHES WILL BE PROVIDED AND AGREED WITH NIEA PRIOR TO WORK BEGINNING ON ANY ELEMENT OF THE BUILDING.
- ALL EXISTING WINDOW SURROUNDS ARE TO BE RETAINED WERE POSSIBLE.
- ALL UPPER FLOOR STRUCTURES TO BE RETAINED WITH NEW FINISHES APPLIED AS AGREED WITH NIEA.
- 9.) CLEAN DOWN EXISTING WALL SURFACES & CHECK FOR DEFECTIVE PLASTER. REPAIR ALL HOLES & CRACKS SMOOTH DOWN TO RECIEVE PAINT FINISH. REMOVE DEFECTIVE PLASTER AND REPAIR WITH LIME PLASTER LEAVING SMOOTH FINISH TO TAKE PAINT FINISH
- 10) ANY REMOVED HISTORIC FEATURES TO BE TAGGED, RECORDED AND STORED IN A SAFE PLACE FOR RE-USE.
- 11.) ALL ROOMS EXCEPT PRINCIPAL ROOMS 1-5 LEVEL 0
 (INDICATED ON DRAWING NO (1175-01-02) AS
 P1,P2,P3,P4,P5) TO HAVE ALL INTERNAL
 PARTITIONS/FIXINGS PROPOSED FOR REMOVAL
 INDICATED ON THE KEY WITH RED HATCHING.
- 12.) ALL REPAIRS TO EXTERNAL BRICKWORK TO BE DONE WITH LIME MORTAR
- WIDTH OF DOUBLE GLAZING TO MATCH THAT OF EXISTING REFURBISHED WINDOWS. REFER TO DWG PL-14 FOR LOCATION OF WINDOW TYPES.

Drawing



DRAWING NO: 1175 - P - EL - 08 PROPOSED SHORT ELEVATIONS

Revision/Date Change Approved B

RMI